

## **XX315A INDICATOR**

### **Basic Operating Instructions**

TURN THE UNIT ON BY PRESSING THE  $\Phi$  BUTTON. TURN THE UNIT OFF BY PRESSING THE "STOP" BUTTON.

1. TO CHANGE FROM LB TO KG : PRESS AND HOLD \* FOR TWO TO THREE SECONDS UNTIL KG SHOWS ON INDICATOR.
2. TO TARE SCALE : PRESS 0 TO ZERO TARE VALUE. PRESS 0 AGAIN TO CLEAR THE STORED VALUE.
3. TO ENTER A MANUAL TARE : PRESS  $\rightarrow$  BUTTON TO MOVE FLASHING CURSOR TO DESIRED POSITION. PRESS  $\uparrow$  TO CHANGE VALUE. ONCE DESIRED VALUE IS ENTERED, PRESS 0 TO STORE TARE VALUE AND TARE SCALE.
4. TO SET INDICATOR TO PEAK HOLD : IN NORMAL WEIGHING MODE PRESS \* BUTTON TWICE. "AUT 0" WILL BE DISPLAYED. PRESS  $\uparrow$  TO CHANGE VALUE UNTIL "AUT 6" IS DISPLAYED. PRESS \* TO ACCEPT CHANGES. WHEN WEIGHT IS APPLIED IT WILL HOLD PEAK VALUE. PRESS 0 TO CLEAR DISPLAYED VALUE.
5. TO SET INDICATOR TO NORMAL WEIGHING MODE : IN PEAK HOLD MODE PRESS \* TWICE. "AUT 6" WILL BE DISPLAYED. PRESS  $\uparrow$  ONCE. "AUT 0" WILL BE DISPLAYED. PRESS \* TO ACCEPT CHANGES. WHEN WEIGHT IS APPLIED THEN REMOVED, VALUE WILL RETURN TO ZERO.

## Division and Capacity Setup

With power OFF, press and hold “0”. Power indicator on by pressing Red “1”. Continue holding for 4 seconds.

After countdown, press “\*“, will display “cal sp”.

Press “\*“, will display “Set”

Press “→”, will display “d” and should followed by the number “1”

If the displayed number is anything other than “1” Press the “↑” until “1” is displayed.

Press “\*“, will display the capacity.

If the number displayed is anything other than “5000”, press the “→”.

The display will show all 0’s with one of them flashing. Use the “→” to move the flashing cursor, and the “↑” to change the displayed value.

Use this method to change the displayed value to display “5000”

Press the “\*” to scroll through the rest of the settings, and the indicator returns to the normal weigh mode.

Check the scale to ensure that it is weighing correctly. If the scale is not weighing correctly, you will need to recalibrate it.

If the scale is displaying the correct weight, press the “Stop” button.

You may now restart the scale and begin weighing.

## **XK 315A Calibration Procedure**

With power OFF, press and hold “ 0 “. Power indicator on by pressing “ 1 “. Continue holding for 4 seconds.

After countdown, press “ \* “, will display “ cal sp “.

Press “ → “, will display “ cal 00 “.

With no weight on the scale, press “ \* “, will display “ ----- “.

Indicator will then display the default weight for calibration.

Load span weight onto scale.

Press “ → “ to move flashing cursor.

Press “ ↑ “ to change the value of the flashing number.

- • Use this method to change the displayed value to reflect the value of the weight that is on the scale.
- • Weight will have to be converted to kg for calibration purposes. Divide weight by 2.205 for conversion.

Once value is entered, press “ \* “, will display “ ----- “, then display actual weight.

Power the indicator off by pressing “ stop “.

Restart indicator and weigh.